



Mars Labs
29 C Street
Laurel, MD 20707

June 18, 2015

Document # SB-2325-1

Service Bulletin

Titan Mini-Recorder Firmware v0.34.20 – Bug Identified

Summary: A bug was discovered in Titan High Speed v0.34.20 firmware after it was released. The bug affects large positive and negative gain values as follows:

Selecting +256 results in an actual gain of +128
Selecting -256 or -512 does not work properly

This bug was introduced as a result of implementing negative gains (gain inversion) in this latest release; previous firmware releases are unaffected.

We are currently in the process of correcting the issue and anticipate having a new release available very soon. When the new release is posted, a service bulletin will be issued with the announcement.

Recommendations:

If you have not already updated to v0.34.20:

Do not update at this time. A new release is pending.

If you have already updated to v0.34.20:

1. Do not use the offending gain values.
2. If your test requires a gain of +256, install the previous version of the firmware (v0.34.16 – available on the Mars Labs Knowledge Base)

Help: For additional information or assistance, please contact:

Mars Labs
Phone: 301-470-3278
Email: support@marslabs.com
www.marslabs.com